HELICOIL® Plus installation mandrels without depth stop

for processing of thread inserts type HELICOIL® Plus Free Running



Installation mandrel without depth stop to process HELICOIL® Plus Free Running coil thread inserts with metric thread.

Note:
Does not fit HELICOIL® Plus Screwlock.


Technical information can be found on the last page.

Diameter (d)	Article number	Pitch (P)
M 2	41500102000	0.40
M 2.5	41500125000	0.45
M 3	41500103000	0.50
M 3.5	41500135000	0.60
M 4	41500104000	0.70
M 5	41500105000	0.80
M 6	41500106000	1.00
M 7	41500107000	1.00
M 8	41500108000	1.25
M 8x1	41500108300	1.00
M 9	41500109000	1.25
M 10	41500110000	1.50
M 10x1	41500110300	1.00
M 10x1.25	41500110900	1.25
M 11	41500111000	1.50
M 12	41500112000	1.75
M 12x1.25	41500112900	1.25
M 12x1.5	41500112400	1.50
M 14	41500114000	2.00
M 14x1.25	41500114900	1.25
M 14x1.5	41500114400	1.50
M 16	41500116000	2.00
M 16x1.5	41500116400	1.50
M 18	41500118000	2.50
M 20	41500120000	2.50
M 22	41500122000	2.50
M 24	41500124000	3.00

All technical data refer to the measure mm


All technical data without obligation. Subject to technical changes and errors.

HELICOIL® Plus thread inserts

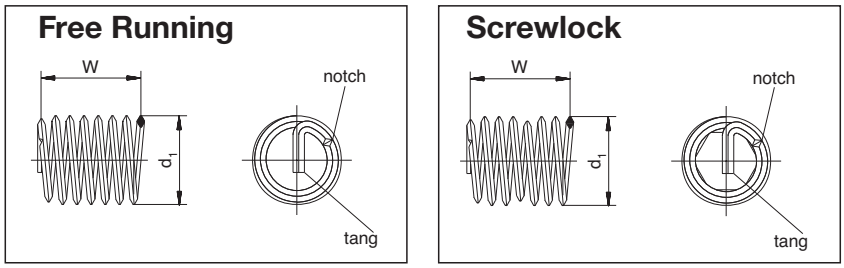


W and d_1 are the control values for thread inserts (Free Running and Screwlock) before they have been installed. The length can only be measured for installed thread inserts.

Holding thread

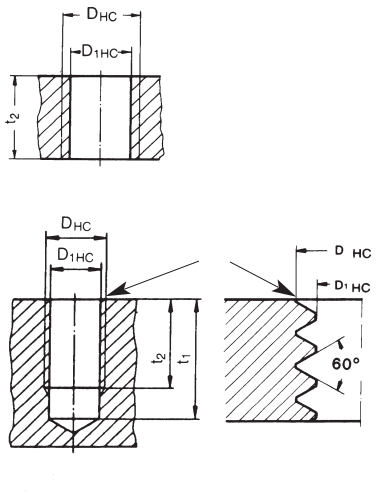

Assembly

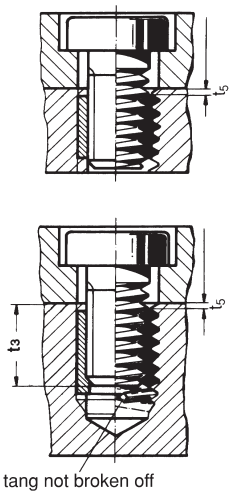

Prior to tapping, counter-bore 90° and deburr.
Outside diameter of **countersink = D_{HC} + 0.1 mm**.

d = Nominal thread diameter
P = Thread pitch
d_1 = Outside diameter of thread insert prior to installation
W = Number of threads prior to installation
D_{HC} = Outside diameter of the parent thread
D_{1HC} = Crest diameter
B = Suitable twist drill diameter. Please note: D_{1HC} is critical for selecting the correct twist drill diameter.
t_1 = Minimum depth of tapped hole according to DIN 76 – Part 1 (guide value)
t_2 = The nominal length of the thread insert corresponds to the minimum length of the full parent thread for blind holes or the minimum plate thickness for a through hole.
t_3 = Maximum screw-in depth when the tang is not removed
t_5 = Distance of the thread insert from the joint face = 0.25 to 0.5 P, if t_2 corresponds to the above-mentioned minimum value

When you use HELICOIL® Plus thread inserts for volume production, we recommend to add at least 1 x P to values t_1 and t_2.

All technical data refer to the measure mm

All technical data without obligation. Subject to technical changes and errors.